Date: January 19, 2016



Technical Service Bulletin

MODEL(S) AFFECTED: T300/T300e Models

Models manufactured in N. America before serial number 10778394 (December 23, 2015)

Models manufactured in Europe before serial number U11213 (November 26, 2015)

SUBJECT: Scrub head lift pedal difficult to disengage from raised position.

PURPOSE: To improve scrub head lift pedal function, order Pedal Latch Upgrade Kit p/n 9014788.

NOTES: Warranty Information: Standard warranty terms apply.

Scrub head lift pedal function.



Old style pedal latch



New kit slide roller assembly



New kit slide roller assembly (Cylindrical models)



WWW.TENNANTCO.COM

The Pedal Latch Upgrade Kit includes the necessary parts to rework all model types (Disk, Orbital and Cylindrical).



Ref	Part No.	Description	Qty.
1	222504	Screw, Hex, Lock, M6 x 1.00, NL, SS	1
2	1028796	Washer, Flat, 0.33B 1.00D .18, STL, PL	2
3	1014020	Roller, 0.99D 0.50B 0.95L, acetal	2
4	222460	Sleeve, p/m, 0.32B 0.50D 0.5L	2
5	01685	Washer, Flat, 0.38B 0.88d .08, SS	1
6	08713	Nut, Hex, Lock, M8 x 1.25, NL, SS	1
7	379829	Washer, Flat, 0.43B 1.50D .12, Stl, PL	1
8	1210103	Spring, Cmpr, 1.23OD 0.085wir 0.88L	2
9	20955	Washer, Flat, 1.03B 1.50D .04, Stl, Pl	2
10	1210112	Washer, Flat 1.03B 1.50D .03, Nylon	2
11	1223078	Bracket Weldment, Latch	1
12	01684	Washer, Flat, 0.27B 0.69D .05 ss	2
13	08712	Nut, Hex, Lock, m6 x 1.00, NL, ss	2
	9014787	Instructions, Kit Installation	1