

Technical Service Bulletin

MODEL(S) AFFECTED: **T600/T600e/T600 EE Walk-Behind Scrubbers**


N. America Models manufactured before S/N T600/T600E/T600EE-10923838 (September 27, 2018)
EMEA Models manufactured before S/N T600/T600E-U00166 (November 26, 2018)
APAC Models manufactured before S/N T600/T600E-30087675 (November 28, 2018)

SUBJECT: Potential damage to plastic solution tank fitting. Reports claim when delivering or storing machines behind one another the scrub head of the rear machine may hit the fitting and damage it. A raised squeegee assembly may also damage the fitting if the squeegee assembly pivots into it with excessive force.

PURPOSE: To repair or prevent fitting damage, replace plastic fitting with brass fitting (p/n 1243587).

NOTES: **Warranty Information:** Standard warranty terms apply.

Installation Note: Before installing brass fitting, drain solution tank and use a threaded pipe sealant on fitting.

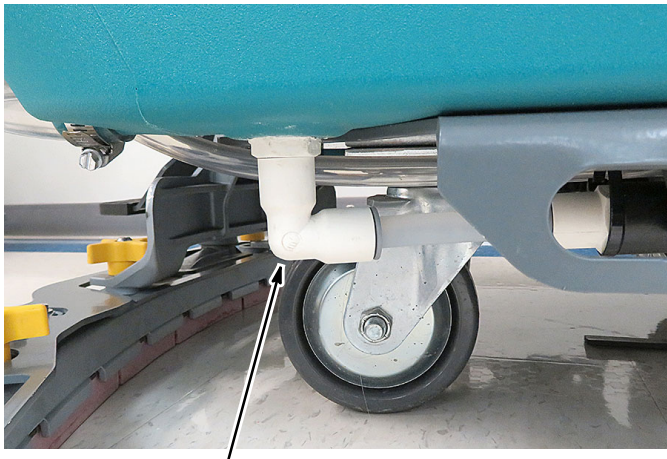

Plastic solution tank fitting



Brass fitting (p/n 1243587)