

Technical Service Bulletin

MODEL(S) AFFECTED: **T600/T600e/T600EE Walk-Behind Scrubbers equipped with membrane control panels**

Model serial number ranges: Americas: T600-10949369-10954484 (May 1 - June 17, 2019), T600e-10949132-10954004 (April 29 - June 13, 2019), T600EE- 10951523 (May 21, 2019)
EMEA: T600-U00300-U00301 (May 28, 2019), T600e-U00294-U00304 (May 5 - June 13, 2019),
APAC: T600-30093757-30094263 (May 16 - June 12, 2019),
T600e-30093690-30094578 (May 16 - June 28, 2019).


SUBJECT: **Battery Discharge Indicator (BDI)** fails to display the LED rippling mode during the charge cycle. A recent User Interface (UI) firmware release has contributed to this behavior glitch.

PURPOSE: To restore the BDI charge cycle behavior install the following User Interface (UI) firmware revisions as instructed below.

- T600 - UI Firmware Rev: 1.03 or later
- T600 Pro-panel - UI Firmware Rev: 1.04 or later
- T600EE - UI Firmware Rev: 1.03 or later
- T600e - UI Firmware Rev: 1.04 or later
- T600e equipped w/ IRIS - UI Firmware Rev: 1.9 or later

NOTES: **Warranty Information:** Standard warranty terms apply.

BDI fails to ripple during charge cycle.

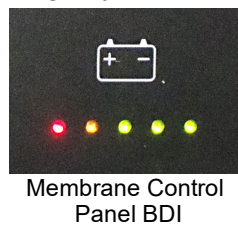

Firmware Update Instructions:

Using the latest Service Diagnostics software version, update the UI Firmware. (T600e model example shown below)

