

GTS Newsletter

2013 / 25E

Machines

Machine	TASKI swingo 350E, 455E
Subassembly	Handle

Switch protection

Increased demands of rocker switches have lead us to analyse this issue in detail. On returns and defective samples it could be determined that the mechanism within the switch was unhinged. Internal tests have shown that this can happen if the handle bumps against an obstacle with high force.



To improve the protection of the switch an additional cover will be mounted with immediate effect.

Description	Material number	Remarks
Cover	4130964 (14620-68)	Existing spare part number

Service Information

- | | |
|--|---|
| ☐ Check parts on stock | ☐ Return defective parts to Münchwilen |
| ☐ Proactive exchange recommended | ☒ NO proactive exchange recommended |
| ☒ Modification is backwards compatible | ☐ Modification is NOT backwards compatible |
| ☐ Update/modify machines in the field | ☐ Entitled to warranty |
| ☐ Dispose/recycle defective parts | ☒ Parts are available ex stock Münchwilen |
| ☒ Others | |

We recommend carrying out this modification for customers which repeatedly complain about failures.

Production

TASKI swingo 350E

as of machine number 8908

TASKI swingo 455E

as of machine number 8575