

Machines

Machine	TASKI swingo XP
Subassembly	Electronic

New Firmware Version 3.34

Feedback from the field as well as internal tests have shown that the machine could head slightly to the right/left although driving straight ahead.

Furthermore we have received an increasing amount of feedback on Error 048 occurring while cleaning. Internal findings have shown that current peaks might appear while driving tight turns during working. This could lead to the situation that certain electronic components reach their limit and put the machine in the "Safe mode" (Error 48).

With the update to firmware 3.34, the adjustment of the machine steering has been refined and the impact of current peaks to the electronic while working is diminished.

Service

We recommend equipping all machines during service visit with the new firmware.

The new firmware is available to download at the e-spares online platform.

⚠ CAUTION

It has to be paid attention that the connection between the machine and the laptop / PC will not be interrupted during the downloading process. If this happens the electronic has to be exchanged.

Production

TASKI swingo XP

as of machine number 5646