

GTS Newsletter

2009/08E

Machines

Machine	TASKI swingo XP
Subassembly	Control Group

Cable Protection Profile

Due to an increasing amount of reports regarding squeezed ribbon cables of the hall sensor electronic in the control group, we introduced a new cable protection profile.



Description	Material no.	Remark
Cable protection profile	4128850 (18603-67)	New part

Service

We recommend upgrading machines with the cable protection profile.

⚠ CAUTION

It has to be paid attention to mount the cable protection profile on the correct side as it is possible to assemble it the wrong way around!

The guidance and throttle parameter **MUST** be taught-in again after assembling the cable protection profile (teach function).

Production

TASKI swingo XP

as of machine no. 5000