



 
GTS NEWSLETTER

TASKI swingo XP

Software: Firmware set

Improved Firmware set

Based on recognised malfunctions and potential for optimisation of the actual firmware set, some adjustments have been implemented.

	Firmware set old	Firmware set new
Version	V 3.08	V 3.17
File name	SW_Swingo_XP_V3_08.7z	SW_Swingo_XP_V3_17.7z
Firmware set		 SW_Swingo_XP_V3_17.7z

Following improvements have been implemented:

Battery indicator

- The battery indicator has been corrected. (The effect that the battery voltage recovers after switching off the machine was not taken into consideration. Therefore the battery indicator could have displayed under certain circumstances a wrong battery level)

Threshold, edge or ramp driving behaviour

- The sensibility of the threshold, edge or ramp driving behaviour is reduced
- The error code E048 does not appear anymore under normal driving conditions for thresholds, edges or ramps

Driving behaviour straight-on driving

- The straight-on driving behaviour of the machine has been corrected

Firmware Set

- The boot loader is not anymore included into the firmware set (faster download)

Service

- The firmware set has to be copied into the corresponding folder of the service tool
- It is advisable to remove the old firmware set from the computer
- By a servicevisit, the firmware set version should be checked
- Update the newest firmware set if not already done

Caution

- The complete machine should be updated with the newest firmware set

Production

TASKI swingo XP with firmware set V3.17

from machine-no. xxxxxxxx1502