

Urgency: **GENERAL:** General information

SYMPTOM:

Brush belt breaking and/or rubbing on housing

PRODUCTS:

Advance: Aquaclean 16ST, 16XP, 18FLX, 18ST

Clarke: Clean Track S16, L18, 18 Wash & Rinse

Nilfisk Grey: AX 410

SYSTEM:

Brush System

ISSUE:

The motor sheave and brush drive sheave are not aligned.

CAUSE:

The sheave on the brush motor shaft must be aligned with the brush drive sheave.

PRODUCTION CORRECTIVE ACTIONS:

The factory uses a spacer of 0.279" (7mm) to set the correct gap to align the sheaves.

FIELD CORRECTIVE ACTIONS:

When installing the sheave on the brush motor set the gap to 0.279" (7mm) as shown below.

