
Attention Service Manager/ Parts Department

Bulletin Level: 2* **Specific Warranty Coverage:** Standard warranty coverage

Subject: Loose squeegee hose connection

Models Affected:

- Adphibian (all models)
- AX651 (all models)

Parts List Form Number(s) Affected: 56042476

ECO# : A-03856

Informational Bulletin: NA

Issue: Poor water pick-up

Cause: Cuff on squeegee hose does not fit tightly with tube portion of squeegee casting 56314325.


Corrective Action: Field:

On machines with SN's prior to those noted below contact Technical Service at 800-989-2235 or ustechserv@nilfisk-advance.com to order sleeve 56317167. Install as as shown in Fig's 2-4.

Factory:

Tube diameter on squeegee casting 56314325 revised to improve fit with squeegee hose cuff. Revised squeegee casting implemented effective with SN 2037724-2037725 & 2048626 on Adphibian.

Fig 1-

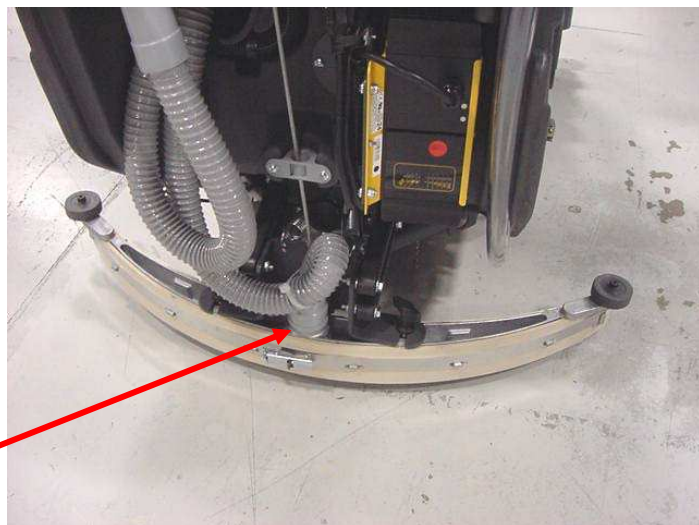

Hose cuff does not fit tightly onto neck of squeegee casting

* **Technical Service Bulletins Levels:**

Level 1: These Bulletins contain general information and are without specific warranty coverage.

Level 2: These Bulletins describe continuous quality improvements that are made to products. Specific warranty coverage may apply and if so is noted in the Bulletin.

Level 3: These Bulletins describe a quality problem that has been determined to require a mandatory update to the product. Specific warranty coverage is as noted in Bulletin.

Fig 2- Remove squeegee and hose

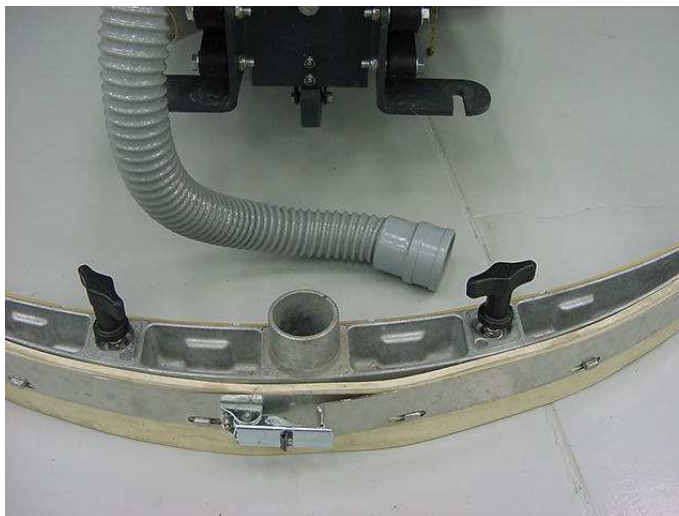



Fig 3-



Install sleeve 56317167
over squeegee casting
tube end and press until
flush with top of tube.



Fig 4-

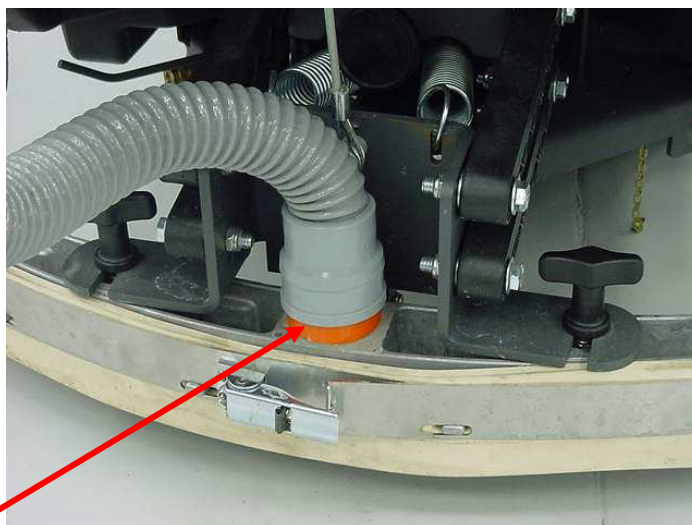

Reinstall squeegee and
squeegee hose