

TECHNICAL SERVICE BULLETIN



Nilfisk

Number: TSB-FC-2022-010-SC-50

Symptom: Squeegee Wheels Locking up due to Debris Ingress.

Date: August 2022

Urgency: Low

Author: Gary Proctor

Urgency:



HIGH: Rework needs to be done immediately



MEDIUM: Rework needs to be done by next possible occasion



LOW: Rework to be done if necessary



GENERAL: General information

PRODUCTS:

SC50 & SC1500

SYMPTOM / ISSUE:

The squeegee wheels pin and washers are made of steel and are rusting due to the collection of debris able to come through the washers. This causes the wheels to stop spinning and lock up resulting in the squeegee dragging, poor water collection and damage to flooring.

OLD KIT



NEW KIT



PRODUCTION SOLUTION IMPLEMENTATION DATE and / or SERIAL NUMBER:

SC 50 Implementation in production starting from S/N **1000073590**

SC 1500 Implemented into production starting from S/N **4000321467**

SPARE PARTS or Kits Needed:

New squeegee wheel kits have been produced to include 2 stainless steel pins 56385498 and extra smaller stainless washers x3 56003646 to prevent rusting and debris build up.

SC50 Squeegee Wheels Kit 56122711

SC1500 Squeegee Wheels Kit 56104385

TECHNICAL SERVICE BULLETIN



Nilfisk

Number: TSB-FC-2022-010-SC-50

Symptom: Squeegee Wheels Locking up due to Debris Ingress.

Date: August 2022

Urgency: Low

Author: Gary Proctor

Urgency:



HIGH: Rework needs to be done immediately



MEDIUM: Rework needs to be done by next possible occasion



LOW: Rework to be done if necessary



GENERAL: General information

FIELD CORECTIVE ACTIONS:

Replace squeegee wheels and new hardware provided in the new kits as required to ensure free movement of the wheels if exhibiting these issues. Please note see below item 24 only the wheel on the right side should have the 2 extra washers.

