

TECHNICAL SERVICE BULLETIN



Nilfisk

Number: TSB-FC-2022-011-SC-50

Symptom: Creaking from front of machine Drive Wheel Area

Date: August 2022

Urgency: General Information

Author: Gary Proctor

Urgency:



HIGH: Rework needs to be done immediately



MEDIUM: Rework needs to be done by next possible occasion



LOW: Rework to be done if necessary



GENERAL: General information


PRODUCTS:

SC50

INFORMATIONAL BULLETIN:

We have had a reported case where the grub screws that hold the chain sprocket on the shaft for the drive chain worked loose causing a creaking noise when driving and the drive chain to be mis-aligned.

Ref : TFR number 20220524-002

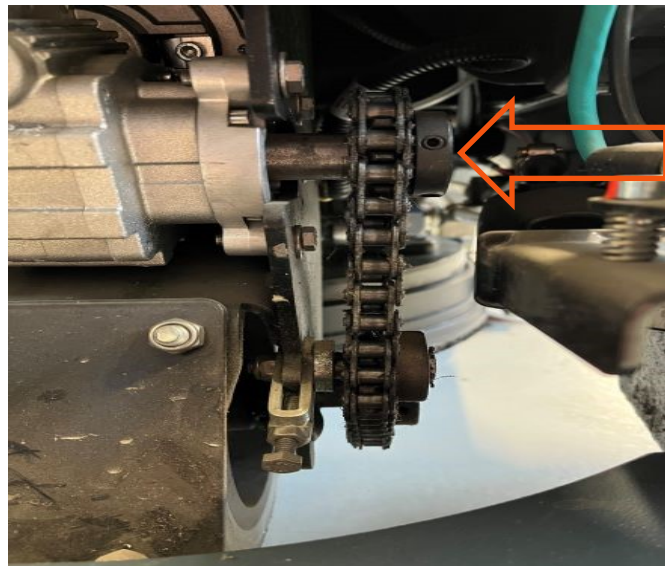

PRODUCTION SOLUTION IMPLEMENTATION DATE and / or SERIAL NUMBER:

A new procedure in production has been introduced to torque, record and calibrate the tools that set the values of the grub screw 56003363 to the correct specification which is 96 in-lb or 10.8 Nm.

SC 50 -Values corrected in production starting from S/N **1000074287**

FIELD CORRECTIVE ACTIONS:

Please be aware of this and if you have a SC50 exhibiting these symptoms please check this first as it could be the issue or on your regular preventative maintenance visits.

PLEASE REMEMBER TO DISCONNECT BATTERY POWER FIRST WHEN WORKING IN THIS AREA DUE TO THE DANGER OF THE STEERING CENTERING ITSELF!!!