


Technical Service Bulletin

MODEL(S) AFFECTED:	T1 Battery Scrubber equipped with AGM Battery (Model No.: 9008635, 9008636) Only models manufactured before serial number 10550969 (December 2011)
SUBJECT:	Battery damage due to over-discharge. If machine is not used and left off charger for extended periods, beyond one month, the internal battery discharge indicator (BDI) will continue to draw power from battery resulting in possible battery damage. If battery voltage drops into the over-discharged range, the battery charger will not operate therefore prevent battery to take a charge.
PURPOSE:	To protect battery from over-discharging, order the upgraded BDI jumper harness (p/n 1069703). The upgraded jumper harness is equipped with BDI charge relay as shown below.
NOTES:	This upgrade is intended on machines if replacing a damaged AGM battery or when servicing machine on a non-related issue. For questions, contact the Tennant Customer Service Department. Warranty Information: Standard warranty terms apply.

Upgraded BDI Jumper Harness (p/n 1069703)

Installed on models manufactured after serial number 10550969.

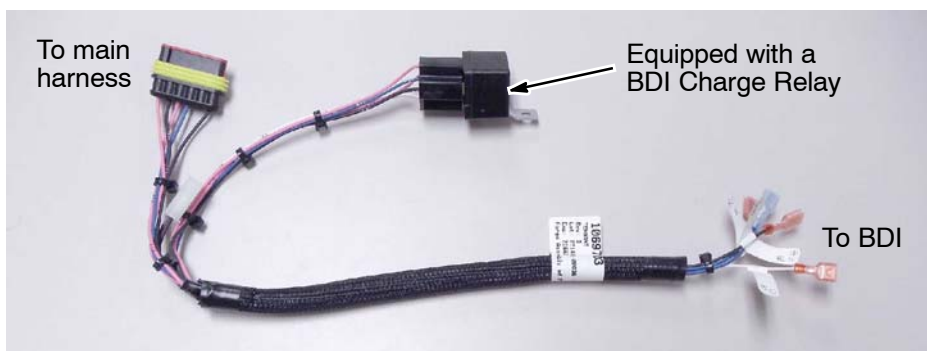

Discontinued BDI Jumper Harness (p/n 1064899)

Installed on models manufactured before serial number 10550970.
Now obsolete replaced by 1069703.



NOTE: If storing a machine that is not equipped with the BDI relay for extended periods, it's suggested to disconnect the battery cable connections.

