


Technical Service Bulletin


MODEL(S) AFFECTED: **T1 Corded Floor Scrubber, E5 Carpet Extractor and R3 ReadySpace Carpet Cleaner**

SUBJECT: If you are experiencing wall outlets equipped with ground fault circuit interrupter (GFCI)/residual-current device (RCD) tripping while operating machine, the brush motor(s) may be subject to current leakage due to excessive carbon brush dust buildup.


PURPOSE: If you have experienced the above condition, order new replacement motor, see list below, to resolve issue. The carbon brush holders are modified and a di-electric coating is included inside end-bell on new motor. The new brush motors were implemented into production starting in May through October of 2013.

NOTES: **Warranty Information:** Standard warranty terms apply.

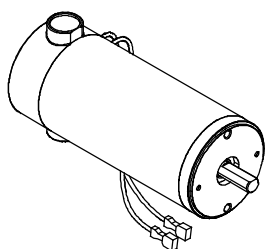
New Brush Motor Replacement				
	<u>Models</u>	<u>120V Motor p/n</u>	<u>230V Motor p/n</u>	<u>Replacement Carbon Brush Kit</u>
	T1	1072719	1072720	1067897
	E5	1072719	1072720	1067897
	R3	1072721 (2)	1072722 (2)	1067897

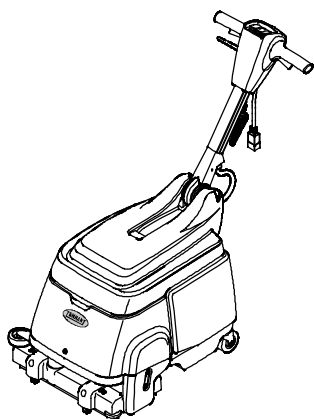

T1 Model Part Numbers
9004191 (120V)
9004195 (230V)

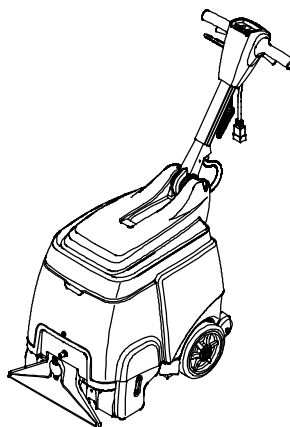

E5 Model Part Numbers
9004194 (120V)
9004198 (230V)

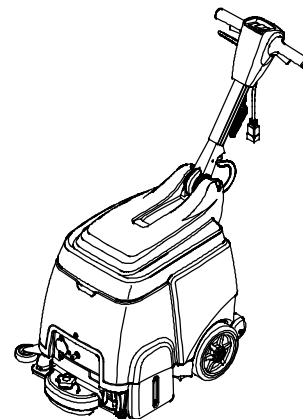

R3 Model Part Numbers
9004192 (120V)
9004199 (230V)