



TECHNICAL SERVICE BULLETIN

Subject: New drain hose
Product(s): Mid WB scrubber
System: Recovery
Number: TSB-FC-2013-111
Date: 22 Apr 2013
ODM / ECO: 5053
Urgency: Level 2

SYMPTOM / ISSUE:

Premature damage of the drain hose.

CAUSE:

- 1) Poor resistance to chemicals of the PVC material.
- 2) Hose too stiff prematurely worn out during draining operation/recovery tank cleaning.

PRODUCTION CORRECTIVE ACTIONS:

Change from PVC to PU material in order to:

- 1) Increase the chemical resistance.
- 2) The new metal spiral shape and the PU material offer higher flexibility and higher mechanical resistance.

LIST OF THE MACHINES IMPROVED:

Nilfisk BA/CA 451/531 – Advance Adfinity 17

Nilfisk BA/CA 551/611 – Advance Adfinity 20

Nilfisk BA 651/751/851

ALTO SCRUBTEC 5xx

ALTO SCRUBTEC 6xx – Clarke Focus II

SOLUTION IMPLEMENTATION DATE and / or SERIAL NUMBER:

First production machine with implemented changes:

Hose type: 9099165000

Machine: 908 7157 020

First serial number: 3510131602256

Implementation date: 18.04.2013

Hose type: 9099166000

Machine: 9087203020

First serial number: 3510131501320

Implementation date: 15.04.2013

Hose type: 9097381000

Machine: 9087240020

First serial number: 3510131303195

Implementation date: 03.04.2013

* Technical Service Bulletin Levels:

Level 1: These Bulletins contain general information

Level 2: These Bulletins describe continuous quality improvements that are made to products

Level 3: These Bulletins describe a quality problem that has been determined to require a mandatory update to the product. Specific warranty coverage is as noted in Bulletin.

Subject: New drain hose
Product(s): Mid WB scrubber
System: Recovery
Number: TSB-FC-2013-111
Date: 22 Apr 2013
ODM / ECO: 5053
Urgency: Level 2

SPARE PARTS:

Running change of the existing part Nr:

- 9099165000 GREY drain hose
- 9099166000 BLACK drain hose
- 9097618000 GREY drain hose kit (BA 651 series)



Issue



OLD



NEW

Subject: New drain hose
Product(s): Mid WB scrubber
System: Recovery
Number: TSB-FC-2013-111
Date: 22 Apr 2013
ODM / ECO: 5053
Urgency: Level 2

FIELD CORRECTIVE ACTIONS:

Replace the hose in the machine prior SN noted,
The new spare parts are available at EDC stock.

Note below the correct hose layout,
Tight strap must be loose to allow hose movement.

