



**Number:** TSB-FC-2014-037

**Symptom:** Scrub Deck Actuator Noisy on CS7000

**Date:** November 12, 2014

**Urgency:** Low

**Author:** Matt Herr

**Urgency:**

☐

**HIGH:** Rework needs to be done immediately

☐

**MEDIUM:** Rework needs to be done by next possible occasion

☒

**LOW:** Rework to be done if necessary

☐

**GENERAL:** General information

**SYMPTOM:**

Scrub deck actuator makes ratcheting sound when machine is turned on.

**PRODUCTS:**

CS7000

**SYSTEM:**

Scrub Deck

**ISSUE:**

Scrub deck sensor is out of alignment

**CAUSE:**

Deck and spacers may be knocked out of adjustment while transporting machine with deck raised.

**ECO / ODM #:**

A-10845

**PRODUCTION CORRECTIVE ACTIONS:**

None required. Field corrective action required only if symptoms experienced.



**Number:** TSB-FC-2014-037

**Symptom:** Scrub Deck Actuator Noisy on CS7000

**Date:** November 12, 2014

**Urgency:** Low

**Author:** Matt Herr

**Urgency:**



**HIGH:** Rework needs to be done immediately



**MEDIUM:** Rework needs to be done by next possible occasion



**LOW:** Rework to be done if necessary



**GENERAL:** General information

**FIELD CORRECTIVE ACTIONS:**

If the symptoms are observed in the field, order and install PROXIMITY SWITCH BRACKET KIT (PN 56384067)

**SPARE PARTS or Kits Needed:**

**56384067** PROXIMITY SWITCH BRACKET KIT

**TOOLS REQUIRED:**

See instruction sheet included in the kit

**COMPONENT LOCATIONS / PICTURES:**



**Prox sensor without adjustable bracket**



**Prox sensor with adjustable bracket**