



Number: TSB-FC-2015-003

Symptom: Exhaust wraps smoking on CS7000

Date: March 31st, 2015

Urgency: Low

Author: Matt Herr

Urgency:

☐

HIGH: Rework needs to be done immediately

☐

MEDIUM: Rework needs to be done by next possible occasion

☒

LOW: Rework to be done if necessary

☐

GENERAL: General information

SYMPTOM:

Smoke or burning smell coming from the Exhaust System on the CS7000

PRODUCTS:

CS7000 (Gasoline & LP Models), Haram Captor II

SYSTEM:

Exhaust System

ISSUE:

Exhaust wraps may deteriorate over time, allowing debris to contact hot exhaust components and possibly cause smoking.

CAUSE:

Exhaust wraps are deteriorating under high heat conditions. Seams may open and trap debris that can create smoke or a burning smell

ECO / ODM #:

A-11060 & A11061

PRODUCTION CORRECTIVE ACTIONS:

Implementing a new exhaust wrap with a higher heat rating and improved closures

PRODUCTION SOLUTION IMPLEMENTATION DATE and / or SERIAL NUMBER:

First production machine with new Exhaust Wraps installed as Standard equipment:

Implementation Shipping Date: 31st March 2015

Serial Number: 1000058700



Number: TSB-FC-2015-003

Symptom: Exhaust wraps smoking on CS7000

Date: March 31st, 2015

Urgency: Low

Author: Matt Herr

Urgency:



HIGH: Rework needs to be done immediately



MEDIUM: Rework needs to be done by next possible occasion



LOW: Rework to be done if necessary



GENERAL: General information

FIELD CORRECTIVE ACTIONS: (New Wraps Available March 31, 2015)


Inspect existing wraps in the field. If they are loose, open, or missing any components, replace with the new exhaust wraps. Be sure to inspect exhaust wraps regularly for debris that may be collecting in and around the seams and clean if necessary.

SPARE PARTS or Kits Needed:

56384190 EXHAUST BLANKET KIT FOR CS7000

56384206 EXHAUST BLANKET KIT FOR HARAM CAPTOR II

COMPONENT LOCATIONS / PICTURES:

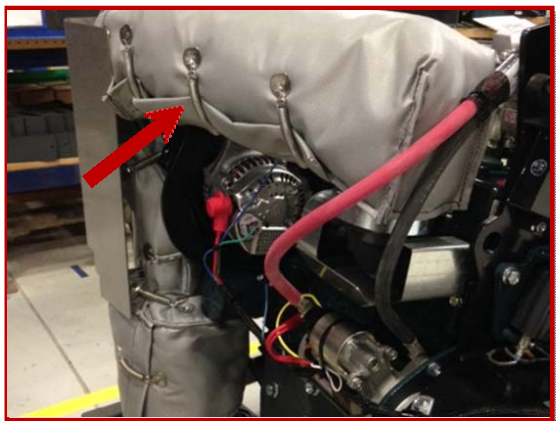

Existing wraps with wire or spring fasteners



New wrap has snaps