

Technical Service Bulletin

MODEL(S) AFFECTED: **T7 Rider Scrubber** - Models manufactured before serial number 10613731 (April 9, 2013).
Models manufactured in Europe before serial number T7xxx06952 (April, 2013).



SUBJECT: Potential drain hose damage due to careless machine operation when transporting with squeegee raised. If the right side of the squeegee assembly strikes a wall or obstruction with excessive force (see photos below), the left edge of the squeegee lift bracket will crush the drain hose causing damage and water leakage.

PURPOSE: To prevent potential drain hose damage you have two options:

1. Install upgraded squeegee lift bracket (p/n 1018725) which is slightly smaller in width that will provide ample clearance if squeegee assembly strikes a wall or obstruction with excessive force.
2. As an alternative to replacing the bracket, install a longer piece of protective edging (p/n 1020168) on the existing squeegee lift bracket as shown below.


To identify the upgraded bracket from an old bracket, the upgraded bracket measures 12.75 inches (32.4 cm) in width compared to the old bracket that measures 13.5 inches (34.3 cm).

NOTES: **Warranty Information:** The machine upgrade (squeegee lift bracket) is not covered under warranty.

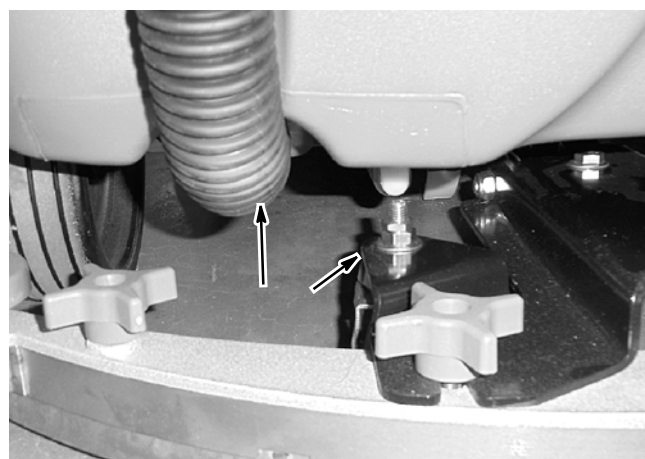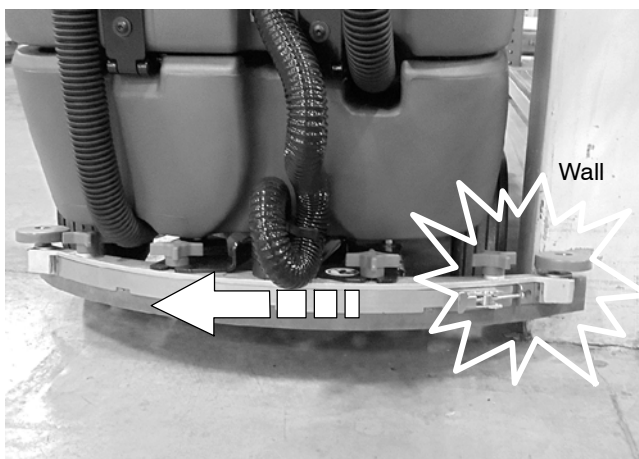

When squeegee assembly strikes a wall with excessive force, the left side of the squeegee lift bracket will crush drain hose.

Solution Option 1: (preferred)

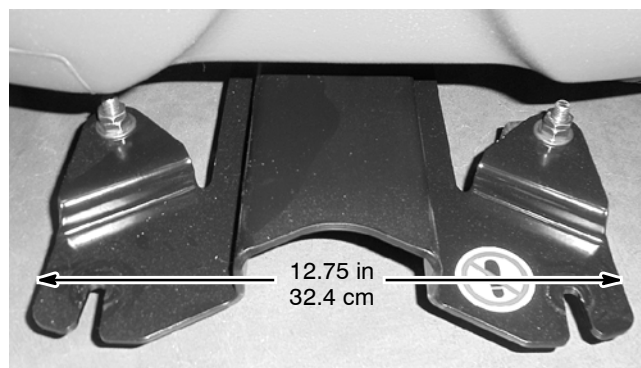

Install upgraded bracket (p/n 1018725). The width of the upgraded bracket measures 12.75" (32.4 cm).

Solution Option 2:



Remove existing protective edging and install longer piece as shown (p/n 1020168).