



Nilfisk

TECHNICAL SERVICE BULLETIN

Number: TSB-FC-2018-013
Symptom: Oil leak from transaxle
Date: 30/11/2018
Urgency: Low
Author: Alberto Rastelli

Urgency:

☐

HIGH: Rework needs to be done immediately

☐

MEDIUM: Rework needs to be done by next possible occasion

☒

LOW: Rework to be done if necessary

☐

GENERAL: General information

SYMPTOM:

Oil leak from transaxle or drive wheels do not turn.

PRODUCTS:

SC500

ECO / ODM #: 1007152

ISSUE: Locked drive wheel and/ or Oil leaking at the transaxle.

CAUSE:

After long time usage the hair, and long fibers can roll up around the shaft and lock the drive wheel.

PRODUCTION CORRECTIVE ACTIONS:

Add a cover for the wheel in order to avoid that the hair or the dirty push between the shaft and the bearing ball.

PRODUCTION SOLUTION IMPLEMENTATION DATE and / or SERIAL NUMBER:

Implementation start in production with first S/N **3510182701642** , W27 2018.

FIELD CORRECTIVE ACTIONS:

It is possible to improve the field SC500 scrubber reliability by adding the new shield KIT.

TECHNICAL SERVICE BULLETIN



Nilfisk

Number: TSB-FC-2018-013

Symptom: Oil leak from transaxle

Date: 30/11/2018

Urgency: Low

Author: Alberto Rastelli

Urgency:



HIGH: Rework needs to be done immediately



MEDIUM: Rework needs to be done by next possible occasion



LOW: Rework to be done if necessary





GENERAL: General information

SPARE PARTS or Kits Needed:

9100002594 - CARTER WHEEL PLASTIC KIT

9100000827 - TRANSAXLE KIT WITH CARTER

COMPONENT LOCATIONS / PICTURES:

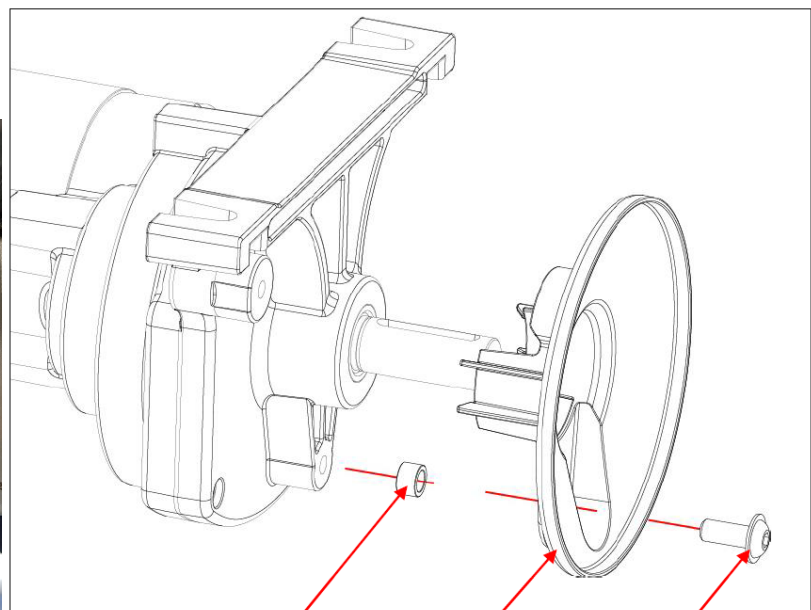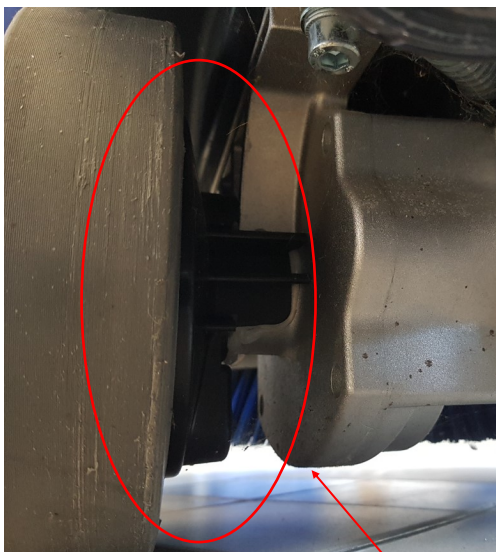

SPACER

CARTER

SCREW

New shield KIT 9100002594