Nilfisk Advance
setting standards

TECHNICAL SERVICE BULLETIN

Subject:	Vacuum Motor Connections
Product(s):	Condor BR1100/BR1300
System:	Recovery
Number:	TSB-FC-2013-116
Date:	18 JULY 2013
ODM/ECO:	A-08772
Urgency:	Level 2

SYMPTOM:

Vacuum motor inoperative
Codes for Vacuum Motor (error code 29)

ISSUE:

Poor connections at the vacuum motor to wiring harness interface

CAUSE:

Poor fitment of the internal connections at the vacuum motor terminals

PARTS LIST NUMBER(S) AFFECTED:

56042498, 56042530, 56042467

PRODUCTION CORRECTIVE ACTIONS:

- Current production connectors upgraded to Delphi, Ducon 6.3 connectors which have heavier contacts and higher current rating.

SOLUTION IMPLEMENTATION DATE and/or SERIAL NUMBER:

- Implementation Shipping Date: 08 April 2013
- Serial Number: 100005000

FIELD CORRECTIVE ACTIONS:

1. Order part numbers **56383234** CONNECTOR ASSY DUCON MALE and **56383235** CONNECTOR ASSY DUCON FEMALE
2. Cut off old connectors and discard, then splice new connectors into existing wiring

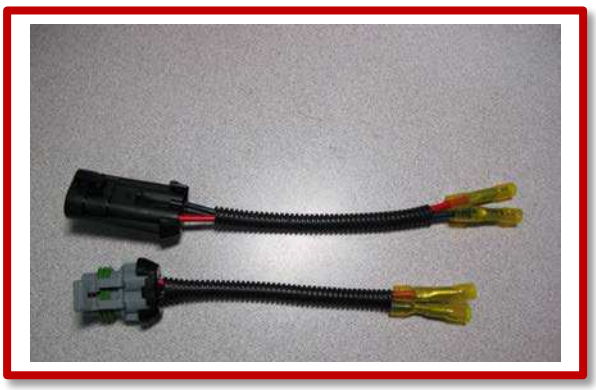

Technical Service Bulletin Levels
Level 1: General Information
Level 2: Continuous Quality Improvement
Level 3: Mandatory Update

Nilfisk Advance
setting standards

TECHNICAL SERVICE BULLETIN

Subject:	Vacuum Motor Connections
Product(s):	Condor BR1100/BR1300
System:	Recovery
Number:	TSB-FC-2013-116
Date:	18 JULY 2013
ODM/ECO:	A-08772
Urgency:	Level 2

COMPONENT LOCATION(S):

Serial Number Tag

Serial Number Tag

Recovery Tank

Vacuum Motor

Technical Service Bulletin Levels

Level 1: General Information
Level 2: Continuous Quality Improvement
Level 3: Mandatory Update