

TECHNICAL SERVICE BULLETIN NSS[®] Enterprises, Inc.

Please post for your Service Department to see

Date: 05/02/11


Affected Products: All Charger 2717DB & 2022DB Models

Problem Description: The current system for adjusting pad pressure can be difficult to use.

Corrective Action: The 6496681 (GUIDE, SPRING) was replaced with an adjustable spring guide, 6497801, and 2391941 (BALL JOINT). The new construction allows for fine adjustment of the pad pressure by loosening the jam nut and threading the spring guide either in or out of the ball joint to adjust the position of the locking collar.

Implementation Date: 02/16/11

Illustration:

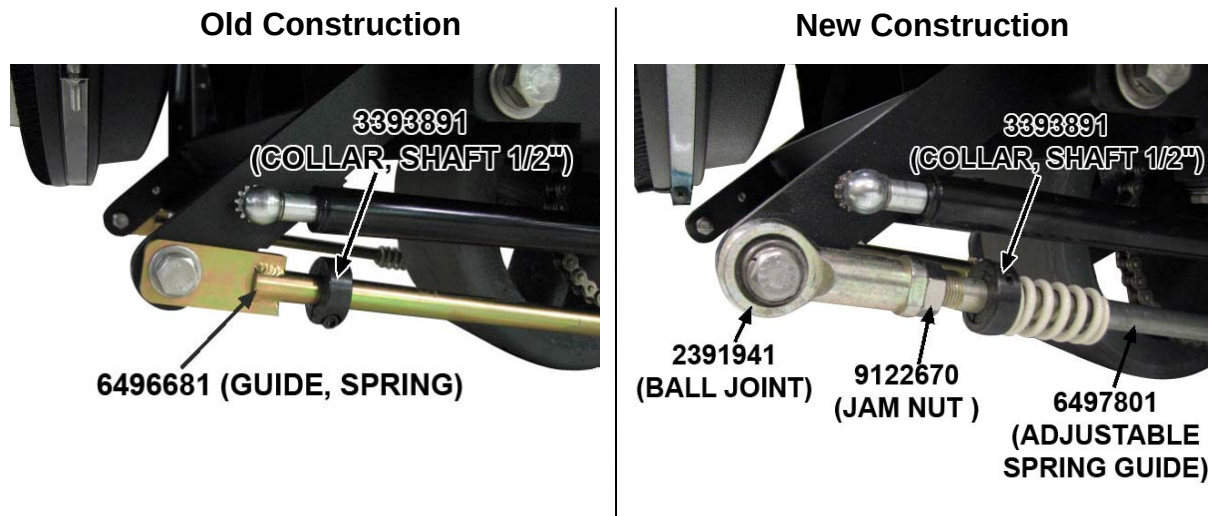

Field Installation: This change is an improvement to the current design, but is not recommended for field installation unless the end-user needs to adjust the pad pressure frequently. Very few end-users should have this need.

**If you have questions please contact:
NSS Technical Services 800-261-3499**