

Technical Service Bulletin

**MODEL(S)
AFFECTED:** **ec-H2O™ models**


Machines manufactured before serial number date code DC0908 (September 12, 2008)

SUBJECT: ec-H2O module control boards may short out if splattered water enters past the rubber grommet. This grommet allows access to the control board settings.

PURPOSE: To prevent control board failure due to water exposure, it is suggested that you replace the existing grommet with the new watertight grommet (p/n 1050431).

NOTICE: When filling or rinsing out solution tanks be careful that the module does not get wet.

NOTES: For questions, contact the Tennant Customer Service Department at (800) 553-8033 or (763) 513-2850. **Warranty Information:** Standard Terms Apply.

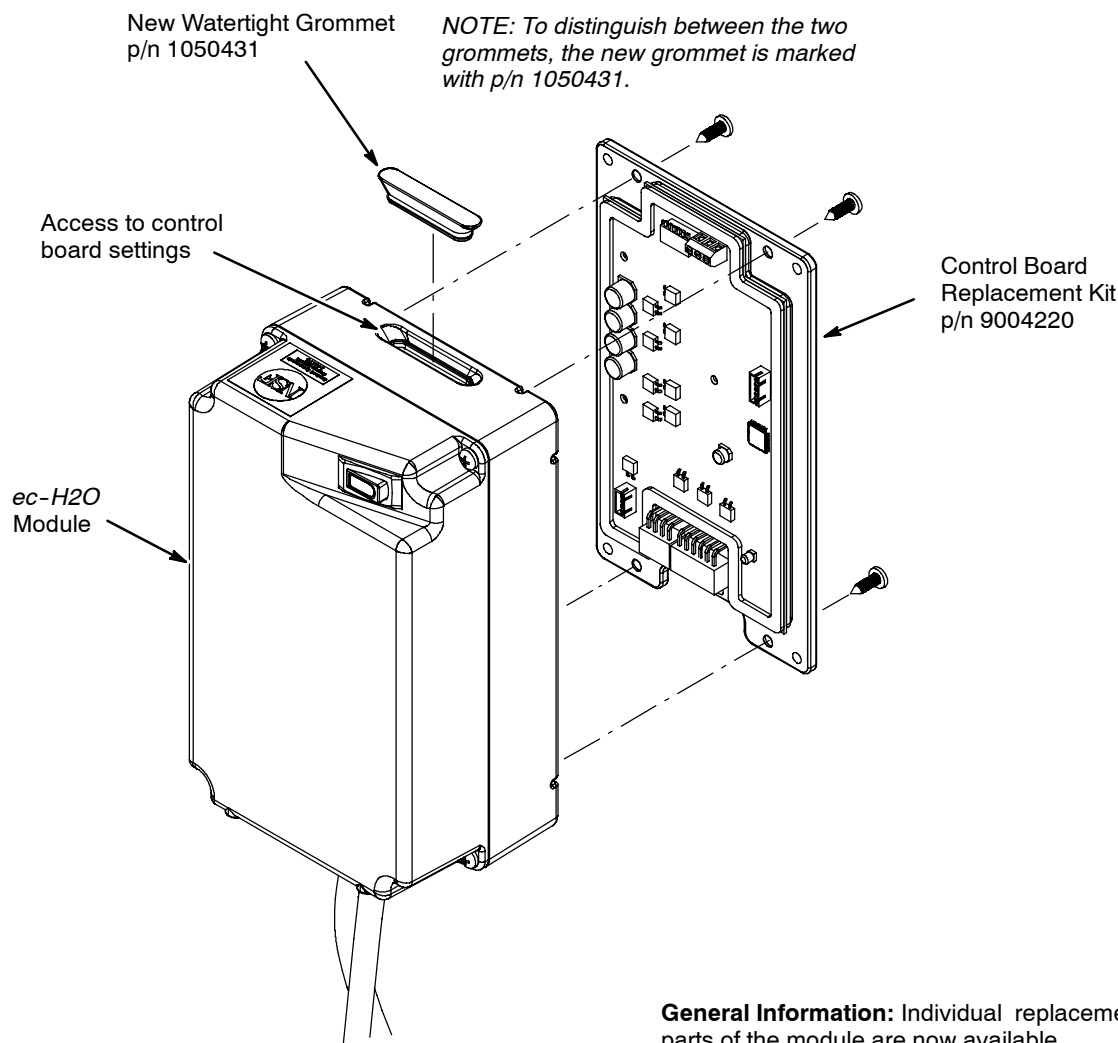

General Information: Individual replacement parts of the module are now available. Refer to your parts list manual.