



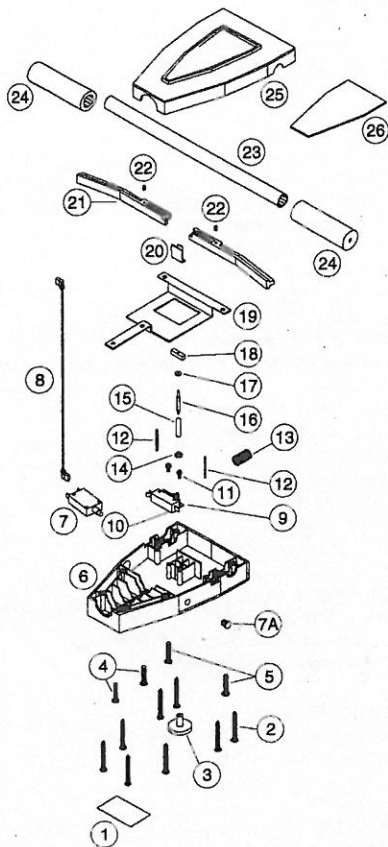

"M" series Pre 2003 handle parts


ref#	order	description	each
1	X8418A	warning label	.27
2	X8820	12 x 2" phil flat TS-A	.11
3	X8805	lock out knob	3.64
	X8804	lock out rod for knob	.54
4	X8849	1/4 x 1-1/4" phil flat mach	.11
5	X8818	1/4 x 1-1/2" phil flat to-f	.11
6	X8002A	bottom handle housing	15.19
7	X8023	circuit breaker, 15a, w/nuts M1200	10.32
	X8023A	circuit breaker, 17a, w/nuts P1500	10.08
7A	X8151C	3/8" hole plug	.11
8	X8009	lead, 14g, blk, 4", w/2 f26	.81
9	X8006	switch bracket	2.67
10	F5P	momentary switch 1901-012104	8.39
11	X8284	8-32 x 3/8" phph, type f	.11
12	X8026	trigger pin	.81
13	X8010	switch spring	.39
14	X8823	lock-out bushing	2.37
15	X8814	spring, od .312, wire dia .025	1.58
16	X8804	lock-out rod	.54
17	X8817	#6 SAE flat washer, black	.15
18	X8803	lock out stop	.53
19	X8806	plate, handle support	3.38
20	X8061	clip switch lever	.67
21	X8003 (2)	handle switches trigger	6.40
22	X8110A	compression spring	1.04
23	X8005	cross bar handle	10.34
24	X8007	handle grip	2.72
25	X8001A	top handle housing	12.44
26	X8815	handle, back, M-series, w/label	3.74

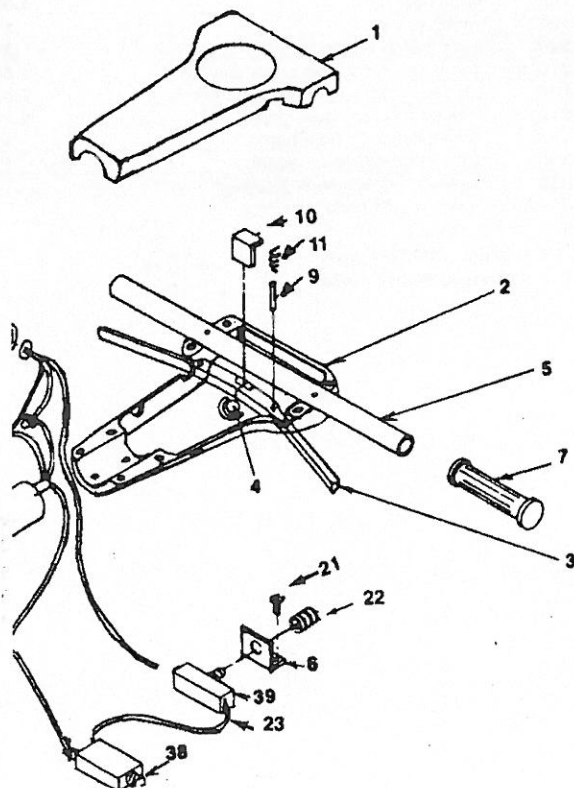

"P" series Pre 2000 handle parts

ref#	order	description	each
1	X8001	top handle housing	12.44
2	X8002	bottom handle housing	12.44
3	X8003 (2)	switch lever	6.40
4	X8004	ball	1.34
5	X8005	handle tube	10.34
6	X8006	switch bracket	2.67
7	X8007	handle grip, 2 req.	2.72
9	X8026	dowell pin, 2 req.	.81
10	X8061	clip switch lever	.67
11	X8110A	spring, dowell pin, 2 req.	1.04
21	X8201	8/32"x3/8" type F screw, 2 req.	.19
22	X8010	switch spring	.39
23	X8009	4" jumper wire	.81
38	X8023	circuit breaker, 15a, w/nuts P1200	10.32
	X8023A	circuit breaker, 17a, w/nuts P1500	10.08
	X8151C	3/8" hole plug	.11
39	F5P	switch-25 amp	8.39
	X8600	switch housing assembly complete with 15 amp breaker	99.18
	X8804	lock-out rod, X8800	.54



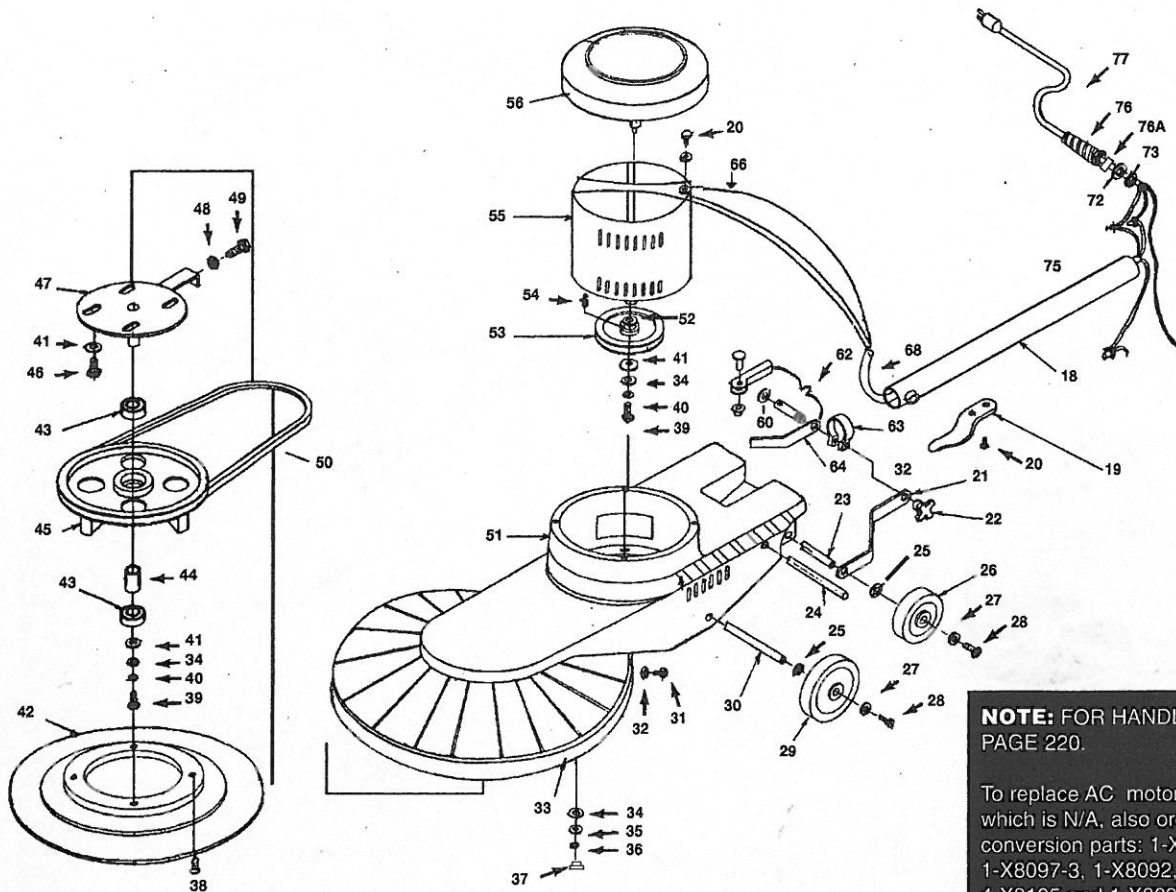

NOTE: FOR HANDLE PARTS SEE PAGE 220.

To replace AC motor, Part #X8037 which is N/A, also order conversion parts: 1-X8099-7, 1-X8097-3, 1-X8092, 2-X8098, 4-X8105 and 1-X8096. (Bearings are pressed in pulley.)

ref#	order	description	each
18	X8011B	handle tube with inserts	38.36
	X8011	handle tube without inserts, P2000	38.36
19	X8013	cord hook	4.42
20	X8207	10-24 x 1/2" type F phil screw	.11
21	X8027L	handle brace, left	10.03
22	X8016	knob	2.81
23	X8029	rear axle	6.91
24	X8018	pivot shaft	8.52
25	X8101	spring washer	.22
26	X8025	4" wheel	11.29
27	X8020	axle washer	.78
28	X8210	1/4 - 20 x 1/2" phil flat head screw	.35
29	X8024	5" wheel	14.77
30	X8025	axle, main wheels	7.99
31	X8208	10-24 x 5/8" phil pan head screw	.13
32	X8225	3/16" flat washer	.11
33	X8030	46" bumper	10.59
34	X8219	3/8" SAE flat washer	.11
35	X8218	5/16" SAE flat washer	.11
36	X8212	1/4" lock washer	.11
37	X8211	1/4-20 x 1" hex cap bolt	.11
38	X8216	5/16-18 x 1-1/2" flat phil., pad holder	.27
39	X8215	5/16-18 x 3/4" hex cap bolt	.18
40	X8217	5/16" split lock washer	.11
41	X8230	3/8" wrought washer	.08
42	X8862	flexible pad driver	66.35
43	X8098	bearing	5.04
44	X8092	bearing spacer	1.55
45	X8096	main pulley	48.00
46	X8223	3/8-16 x 3/4" hex end cap screw	.18
47	X8091	shaft & plate weldment	29.16
48	X8231	5/16-18 hex nut	.11
49	X8227	5/16-18 x 1-1/4" hex tap bolt	.13
50	X8099-1	43" vee belt, P1200	15.09
	X8099-2	41" vee belt, P1600	15.09
	X8099-4	42" belt, P2000 with type B pulley	15.09
	X8099-5	40.5" belt, P1000, P1600 with type B pulley	15.09
	X8099-7	39.5" belt, P1200 with Type B pulley	15.09
51	X8050	base housing	197.42
52	X8170	3/4" USS washer, plated	.19
53	X8097-1	pulley, P2000	39.77
	X8097-2	pulley, P1000, P1600	36.61

ref#	order	description	each
	X8097-3	pulley, P1200	33.59
54	X8047	machine key	.35
55	X8037-1	1-1/2 H.P., 115V, rectified DC motor	547.45
	X8078	1 H.P., 115V, rectified DC motor, P1000 only	388.73
56	X8041B	motor cover	17.57
60	X8028	1/2" hardened washer	.49
62	X8012A	handle clamp assembly	16.71
63	X8012	handle clamp, collar, 1-1/2"	10.75
64	X8027R	handle brace, right	10.03
66	X8021	12" ground wire	.44
67	X8150	cable tie	.23
68	X8022B	line cord	9.50
69	X8202	8-32 x 1/2" phil pan bolt	.08
70	X8150M	cable tie mount	.23
71	X8256	8-32 keep nut	.11
72	X8228	11/16 I.D. flat washer	.23
73	X8100	counter nut	1.11
75	X8062W	counter weight, P2000	5.11
76	SR37	strain relief, metal	(10) 3.75 4.07
76A	SR37A	brass sleeve, strain relief	1.34
77	M1400	14/3, SJTWA 75' cord	45.05
78	SR36	drive pulley spacer	.71
	M1400S	cord with strain relief	45.06
	M1407	12/3, SJWA, 75' cord, P2000	(4) 49.28 54.44
	M1407FS	12/3, SJWA, 75' cord w/metal relief	78.18
NOT ILLUSTRATED			
	X8062W	handle weight, P2000	5.11
	X8213	nut, X8210-1	.32
	X8222	1/4" x 20 x 3/4" socket set screw for X8011 handle	.11
	X8038	60 mfd capacitor AC motor only	23.68
	X8039	340 mfd capacitor AC motor only	6.08
	X8512	carbon brush, for P1000, P1200 and P1600	5.25
	F45P	pad holder center grip	(10) 11.04 (5) 10.98 11.97
	X8108	wheel spacer	.11
	X8034-2	50 amp, 60 cycle rectifier	29.21
	X8180	bottom bearing P1600, P2000	4.08
	X8210-1	screw & nut	1.84
	X8220	#14 x 1/2" phil flat head	.35