

GTS Newsletter

2009/09E

Machine

Machine	TASKI swingo XP
Subassembly	Base


Linear drive Brush unit

Due to an increasing number of linear drive orders, as well as feedback from the field regarding broken fork heads, we introduced a modification kit for the chassis/brush unit. Additionally the fork head is now available as single spare part.

Modification kit Chassis/Brush unit



Picture from underneath

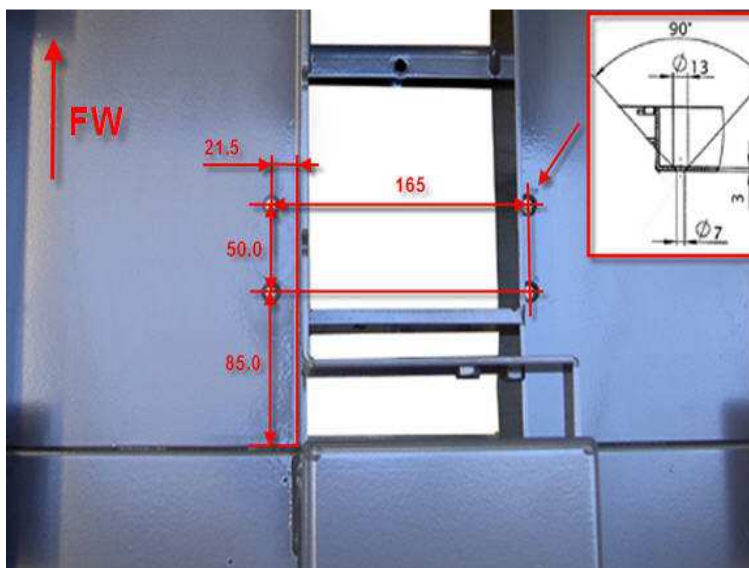

Picture from above (incl. dimensions)

Description	Order Number	Quantity [pcs.]	Remark
Stop	4128772 (18603-64)	1	New spare part
Counters.Hd.Cap Screw M 6x20	4042550 (1292/25)	4	
Washer 6/20	4019790 (1752/15)	4	
Self-Locking Nut M 6	4092870 (1721/106)	4	


4 holes, Ø 7mm (according drawing) have to be drilled into the chassis to complete modification.

⚠ CAUTION


The fixations of the new parts have to be secured with thread locker 4017370 (8936/1).

GTS Newsletter

2009/09E

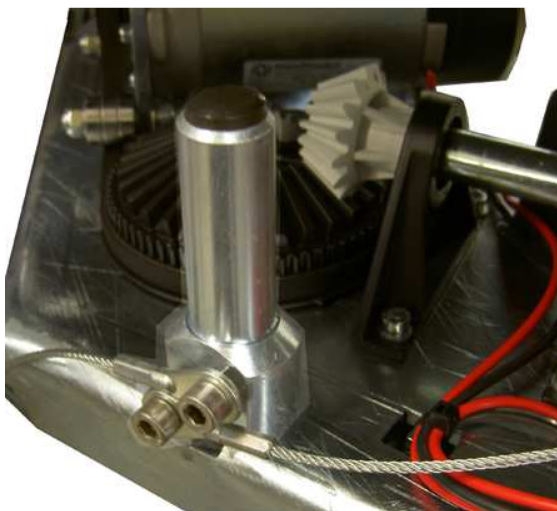

Guidance bolt fixed to motor base plate

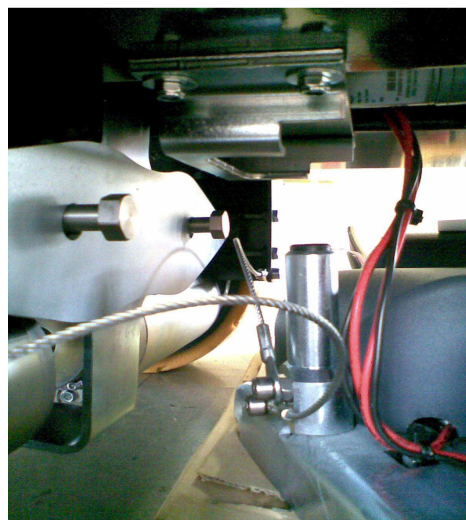


Picture of complete modification

Description	Order Number	Quantity [pcs.]	Remark
Bolt	4128771 (18603-63)	1	New spare part
Stopple 20	4124204 (3061/222)	1	
1752/16 Washer 10,5/21	4027970 (1752/16)	1	
Socket Head Cap Screw M 10x20	4042610 (1132/41)	1	

⚠ CAUTION

To assemble the bolt on the motor base plate the original hole has to be enlarged up to 11 mm.

Fork head

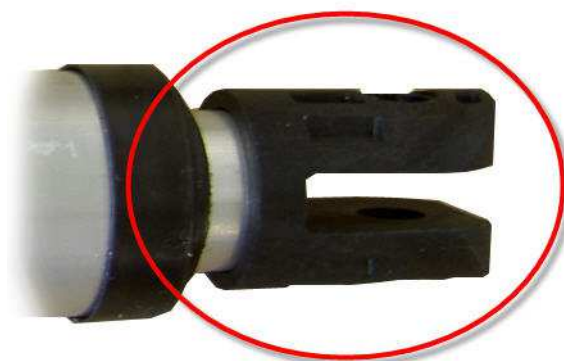

Description	Order Number	Remark
Fork head	4128739 (18603-58)	New spare part

Service

We recommend implementing the modification kit when the linear drive has to be replaced.

Production

TASKI swingo XP

as of machine no. 5000