



GTS NEWSLETTER


TASKI swingo XP

Subassembly: Base

Squeegee lowering

To ensure a more reliable contact pressure of the squeegee on the floor, an extended swinging arm and a stronger linear drive was introduced.

The lugs of the swinging arm were enlarged from 54 to 66 mm.

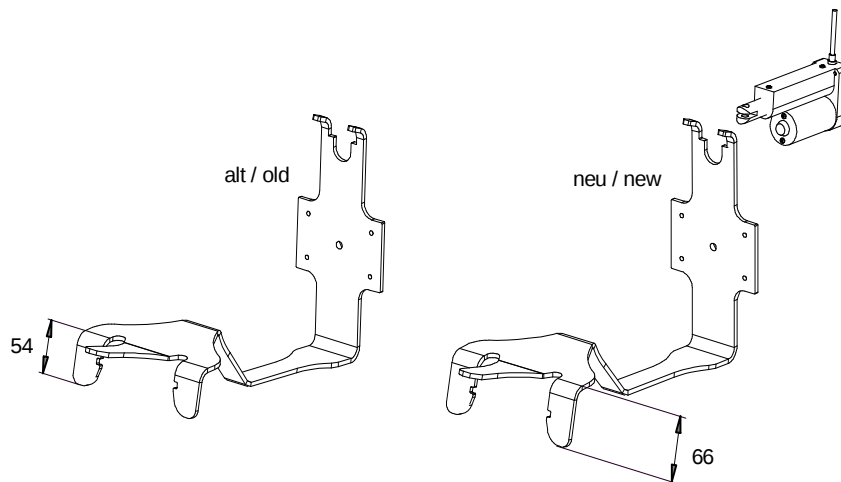

Service

- Instead of the old swinging arm, a new swinging arm and a new linear drive will now be delivered
- The new parts are available as single parts from stock
- With immediate effect, the old parts are not available anymore

	Old		New
Swinging arm	4125454 (18600-91)	Replaced by	4127171 (18602-78) and 4127185 (18602-83)
Linear drive	4125687 (18600-93)	Replaced by	4127185 (18602-83)

Caution

- The correct functioning of the new swinging arm is ensured only when using the new linear drive
- The new linear drive works perfectly with the new as well as with the old swinging arm

Production

TASKI swingo XP with extended swinging arm

from machine-no. xxxxxxxx1533