



GTS NEWSLETTER


TASKI ergodisc 165/200/300/400/Duo assembly drive

Brush housing compl.

By storage the ergodisc in upright position for a longer period and without pad-drive or brush, the brush housing sinistral gets minor deformations.

To avoid this, a second supporting clamp b) is mounted and exonerates the safety protection shield.

These is a complementary measure to the center plug (see TCS Info 2001/02)

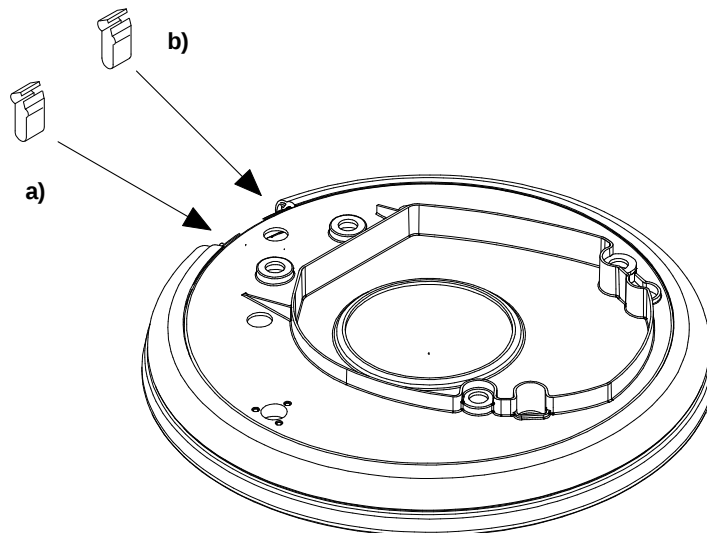

Service

- o All deliveries ex. Münchwilen will be with the new design order No. 4122576 (14604-33) with 2 clamps
- o As spare part is still the supporting clamp set 4117460 (14604-19) available
- o The design change doesn't allow to retrofit old brush housings with a second clamp. The complete brush housing has to be changed
- o TASKI ergodisc range Ø38 and Ø50 will remain as they are

Production

TASKI ergodisc Ø 43 with reinforced brush housing

from machine No. 18242

Since mid of August 2004, only reinforced brush housings will be delivered.