

56331342 LEVER WELDMENT KIT

For Carpetriever™ 28XP

CONTENTS OF KIT

ITEM	PART NO.	QTY	DESCRIPTION
	56040502	1	Instruction Sheet
I	56331348	1	Lever Weldment
K	56331352	1	Gasket
L	56331345	1	Plate
M	56002505	2	Scr, Hex Hd HP5 #6-32 x 3/8


INSTALLATION INSTRUCTIONS

WARNING!

DISCONNECT POWER CORD BEFORE SERVICING.

- 1 Open handle front cover and remove dirt collection bag.
- 2 **See Figure 1.** Disconnect vacuum hose "A" from diverter valve housing "B".

FIGURE 1

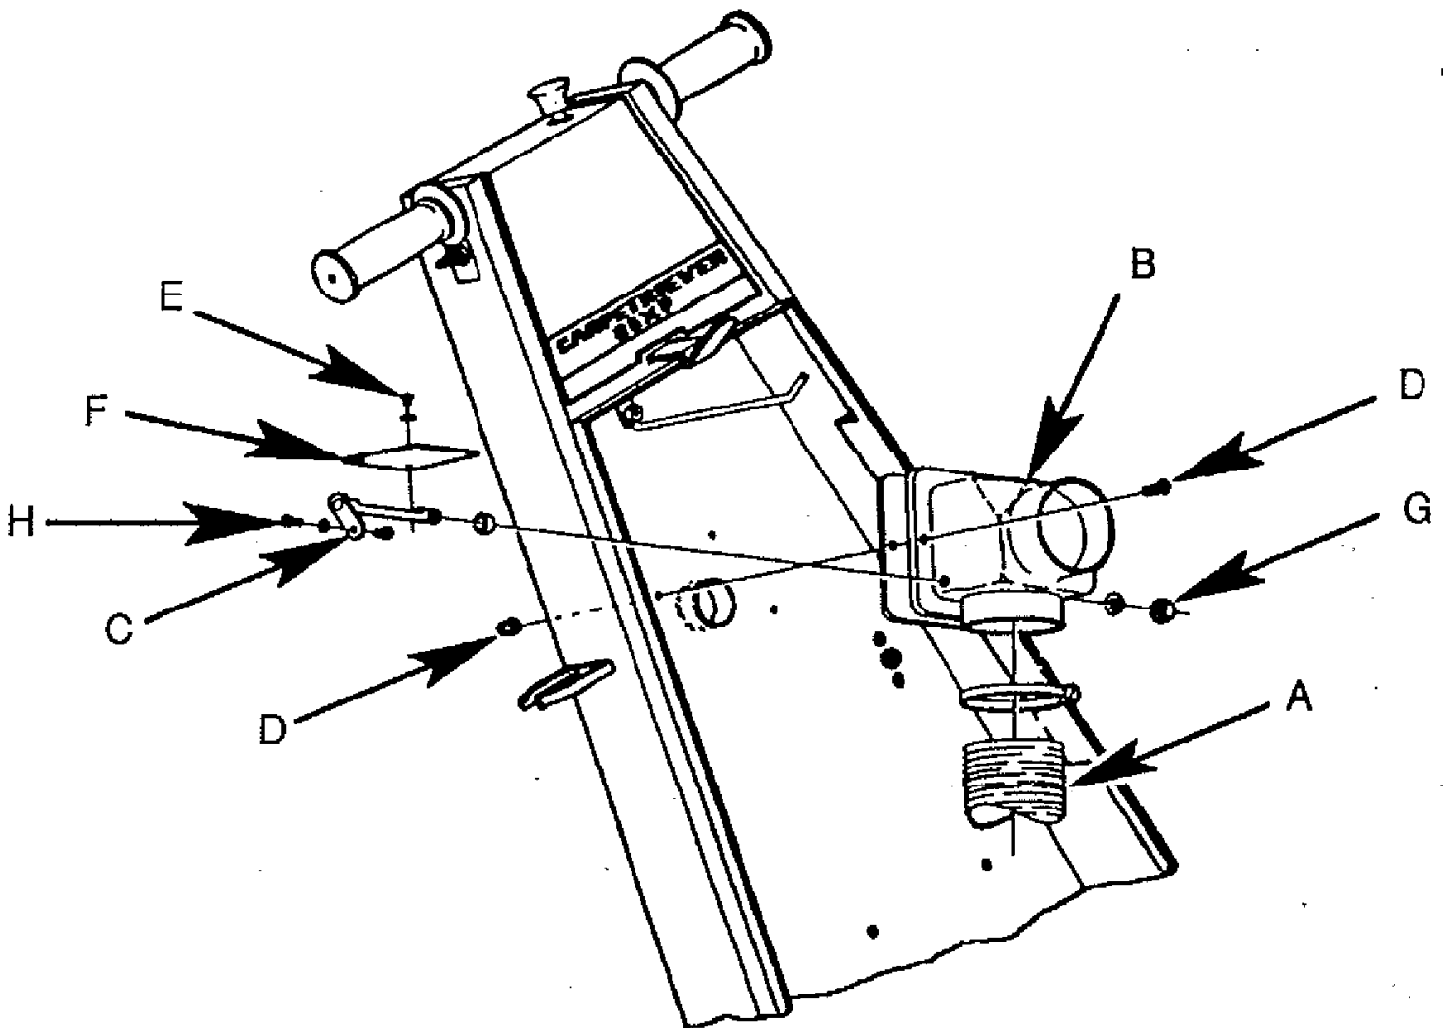

- 3 Disconnect control cable from lever "C".
- 4 Remove the (3) "D" screws and nuts, and remove diverter valve housing "B" from the machine.
- 5 Remove the (2) "E" screws and remove plate "F".
- 6 Remove nut "G" and slide lever "C" out of housing "B".
- 7 **See Figure 2.** Remove wire swivel "H" from old lever "C" and install on new lever "I".
- 8 Install new lever "I" in housing "B" using old nut "G", bushing "J" and washers as shown in figure 2.
- 9 Peel backing off foam "K" and stick to plate "L" as shown in figure 2.
- 10 Fasten plate "L" to lever "I" with (2) "M" screws from the kit as shown in figure 2.
- 11 Follow steps 1-4 in reverse order to reassemble.
- 12 Test the machine to make sure the valve is functioning properly (the cable may need to be adjusted).

FIGURE 2

