
Attention Service Manager/Parts Department

Bulletin Level: 2*

Specific Warranty Coverage: Standard Warranty Coverage

Subject: Foam Guard Panel is available for Kent Champion 28, CarpeTrierer 28, and Nilfisk GU700A and GU700A -60.

Models Affected: CarpeTrierer 28 (115V) (56330020)
Kent Champion 28 (2002 model) (56648330)
Nilfisk GU700A (56330910)
Nilfisk GU700A-60 (56330049)

Parts List Form Number(s) Affected: PL56042384, PL56042434, PL 56042523

ECO#: A-04946

Issue: Tears in paper filter bags have been reported.

Cause: When the paper bag inflates, it can get behind the cardboard panel and contact the arm on the air flap lever when the valve is opened and closed.

Corrective Action: Factory: Effective with serial number 1000034793, a foam Guard Panel, p/n 56380337, is being installed to prevent the flap lever arm from contacting the dust bags. (Refer to Figure 1.)



Figure 1 – Foam Guard Panel, p/n 56380337

* **Technical Service Bulletin Levels:**

Level 1: These Bulletins contain general information and are without specific warranty coverage.

Level 2: These Bulletins describe continuous quality improvements that are made to products. Specific warranty coverage may apply and if so is noted in the Bulletin.

Level 3: These Bulletins describe a quality problem that has been determined to require a mandatory update to the product. Specific warranty coverage is as noted in Bulletin.

Field: If premature failure of the paper dust bag occurs, install the foam Guard Panel as follows:

1. See Figure 2. Open the **Bag Housing Door** and disconnect the **Bag** from the **Intake Tube** on the **Butterfly Assembly**.

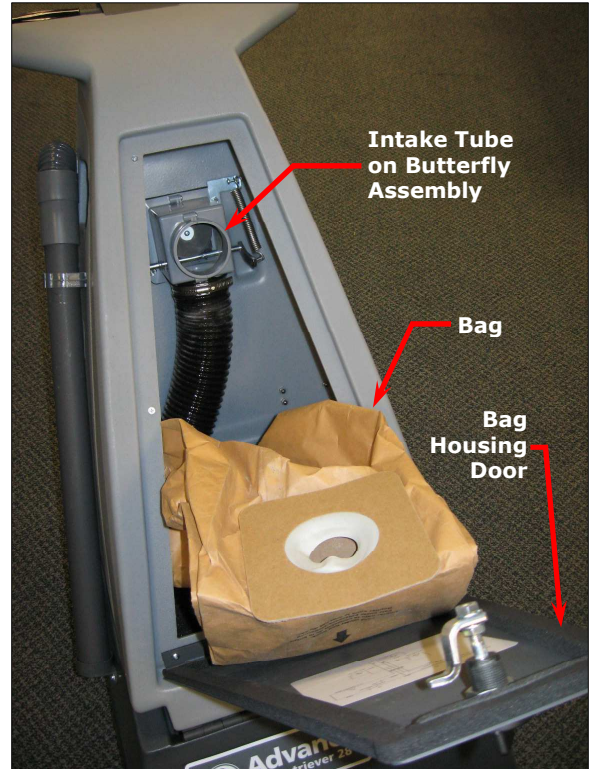


Figure 2 – Bag Disconnected from Intake Tube

2. See Figure 3. Install the foam **Guard Panel** onto the **Butterfly Assembly**.
3. See Figure 2. Reinstall the **Bag** onto the **Intake Tube** on the **Butterfly Assembly**, then close and latch the **Bag Housing Door**.

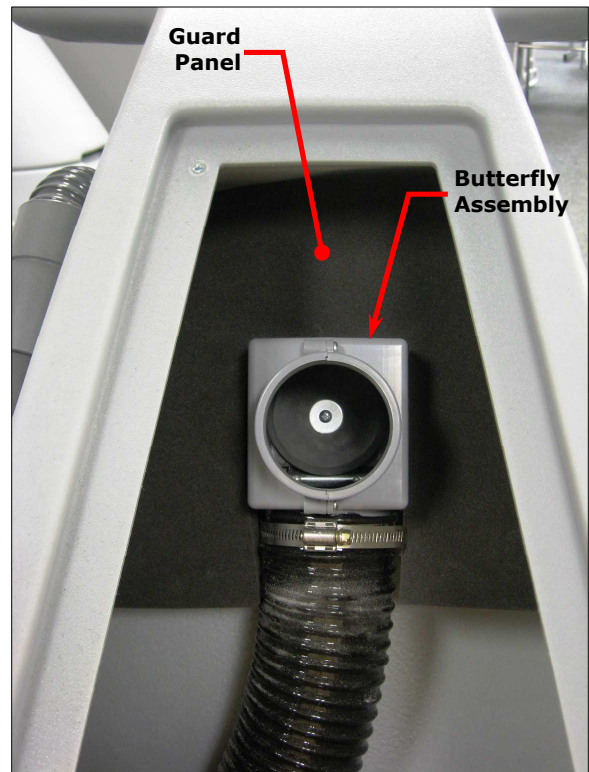


Figure 3 – Installed Guard Panel