

INSTALLATION INSTRUCTIONS				Description
Part No	9097731000	Date	18/03/2008	Installation Instruction for
Page	1/5	Release		KIT SUPPORTO GALLEGGIANTE
Issue by	R&D	Machine type		CAGE FLOAT HOLDER KIT
Name	Odoli	Product index		9097730000

Istruzioni di montaggio per KIT SUPPORTO GALLEGGIANTE 909773000
Assembling Instructions for CAGE FLOAT HOLDER KIT 909773000

Prima di effettuare le varie operazioni procedere nel modo seguente:

- Portare la macchina su un terreno pianeggiante
- Portare la chiave di avviamento in posizione "O" (OFF)


Before installing the cage float holder kit, proceed with the following operations:

- drive the machine on level ground
- turn the ignition switch to the "O" position (OFF)

FIG.1  The diagram shows the components of the kit: A) A large black cage float holder; B) A black O-ring gasket; C) Two small black caps; D) Two metal nut jaws; E) Two metal washers; F) Two metal screws.	Contenuto del kit (FIG.1) A) Supporto galleggiante B) Guarnizione C) Tappi per vecchi fori D) Dadi a griffe E) Rondelle F) Viti <i>Contents of the kit (picture 1)</i> A) Cage Float holder B) Gasket C) Caps for old holes D) Nut jaw E) Washers F) Screws
FIG.2  The top photograph shows the old cage float holder being removed from the machine. The bottom photograph shows the machine after the old components have been removed, with the new kit components visible.	Rimuovere il vecchio supporto galleggiante ed il motore aspiratore. (Fig. 2) (Su alcune versioni non è necessario rimuovere il motore d'aspirazione) <i>Remove the old cage float holder and the vacuum motor, as shown in picture 2</i> <i>(For some versions it is not necessary to remove the vacuum motor)</i>

INSTALLATION INSTRUCTIONS				Description
Part No	9097731000	Date	18/03/2008	Installation Instruction for KIT SUPPORTO GALLEGGIANTE CAGE FLOAT HOLDER KIT 9097730000
Page	2/5	Release		
Issue by	R&D	Machine type		
Name	Odoli	Product index		

FIG.3

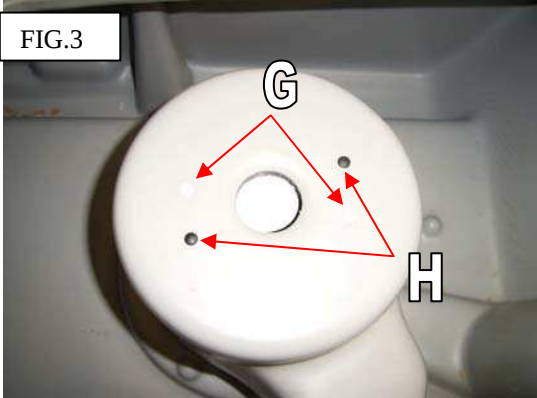

Forare il serbatoio a disegno (vedi tabella 1) e chiudere i vecchi fori con i Tappi "H" (Fig. 3)


Drill new holes (G) with drawing (See table 1) and close the old holes with the caps (H) as shown in picture 3.

TABELLA/ TABLE 1

Scegliere dalla seguente tabella il disegno corretto che corrispondanda alla Vostra lavasciuga:
Choose in the following list the correct drawing which corresponds to your scrubber:

CODE SERBATOIO TANK	CODICE MACCHINA MACHINE	DESCRIZIONE	DESCRIPTION	DISEGNO FORATURA DRAWING HOLES
909701300	9087202020	Lavasciuga FOCUS II	551	C
	9087203020	Lavasciuga FOCUS II BODY		
909 6272 000	908 7124 020	Lavasciuga VANTAGE 17		G
	908 7125 020	Lavasciuga VANTAGE 17		
	908 7126 020	Lavasciuga VANTAGE 17		

INSTALLATION INSTRUCTIONS				Description
Part No	9097731000	Date	18/03/2008	Installation Instruction for KIT SUPPORTO GALLEGGIANTE CAGE FLOAT HOLDER KIT 9097730000
Page	3/5	Release		
Issue by	R&D	Machine type		
Name	Odoli	Product index		

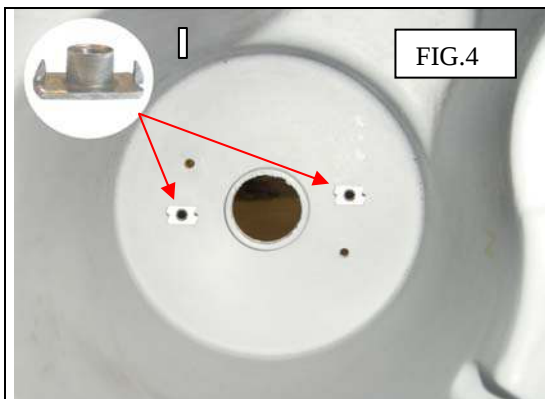

Posizionare e bloccare con l'utilizzo di un martello i dadi a griffe nei nuovi fori (I) all'interno del vano del motore aspirazione. (fig.4)

Place and lock by means of an hammer the nuts jaw in the new holes (I), internal the vacuum motor space as shown in picture 4.



**Posizionare il supporto galleggiante come in fig.5
Orientare il galleggiante come da indicazione del disegno scelto dalla TAB1**


*Place the cage float holder as indicated in picture 5.
Orientate the cage float holder as indicated by the drawing selected from the TABLE 1.*



Riposizionare il motore d'aspirazione (Fig. 6)

Reposition the vacuum motor as shown in picture 6.

INSTALLATION INSTRUCTIONS				Description
Part No	9097731000	Date	18/03/2008	Installation Instruction for KIT SUPPORTO GALLEGGIANTE CAGE FLOAT HOLDER KIT 9097730000
Page	4/5	Release		
Issue by	R&D	Machine type		
Name	Odoli	Product index		

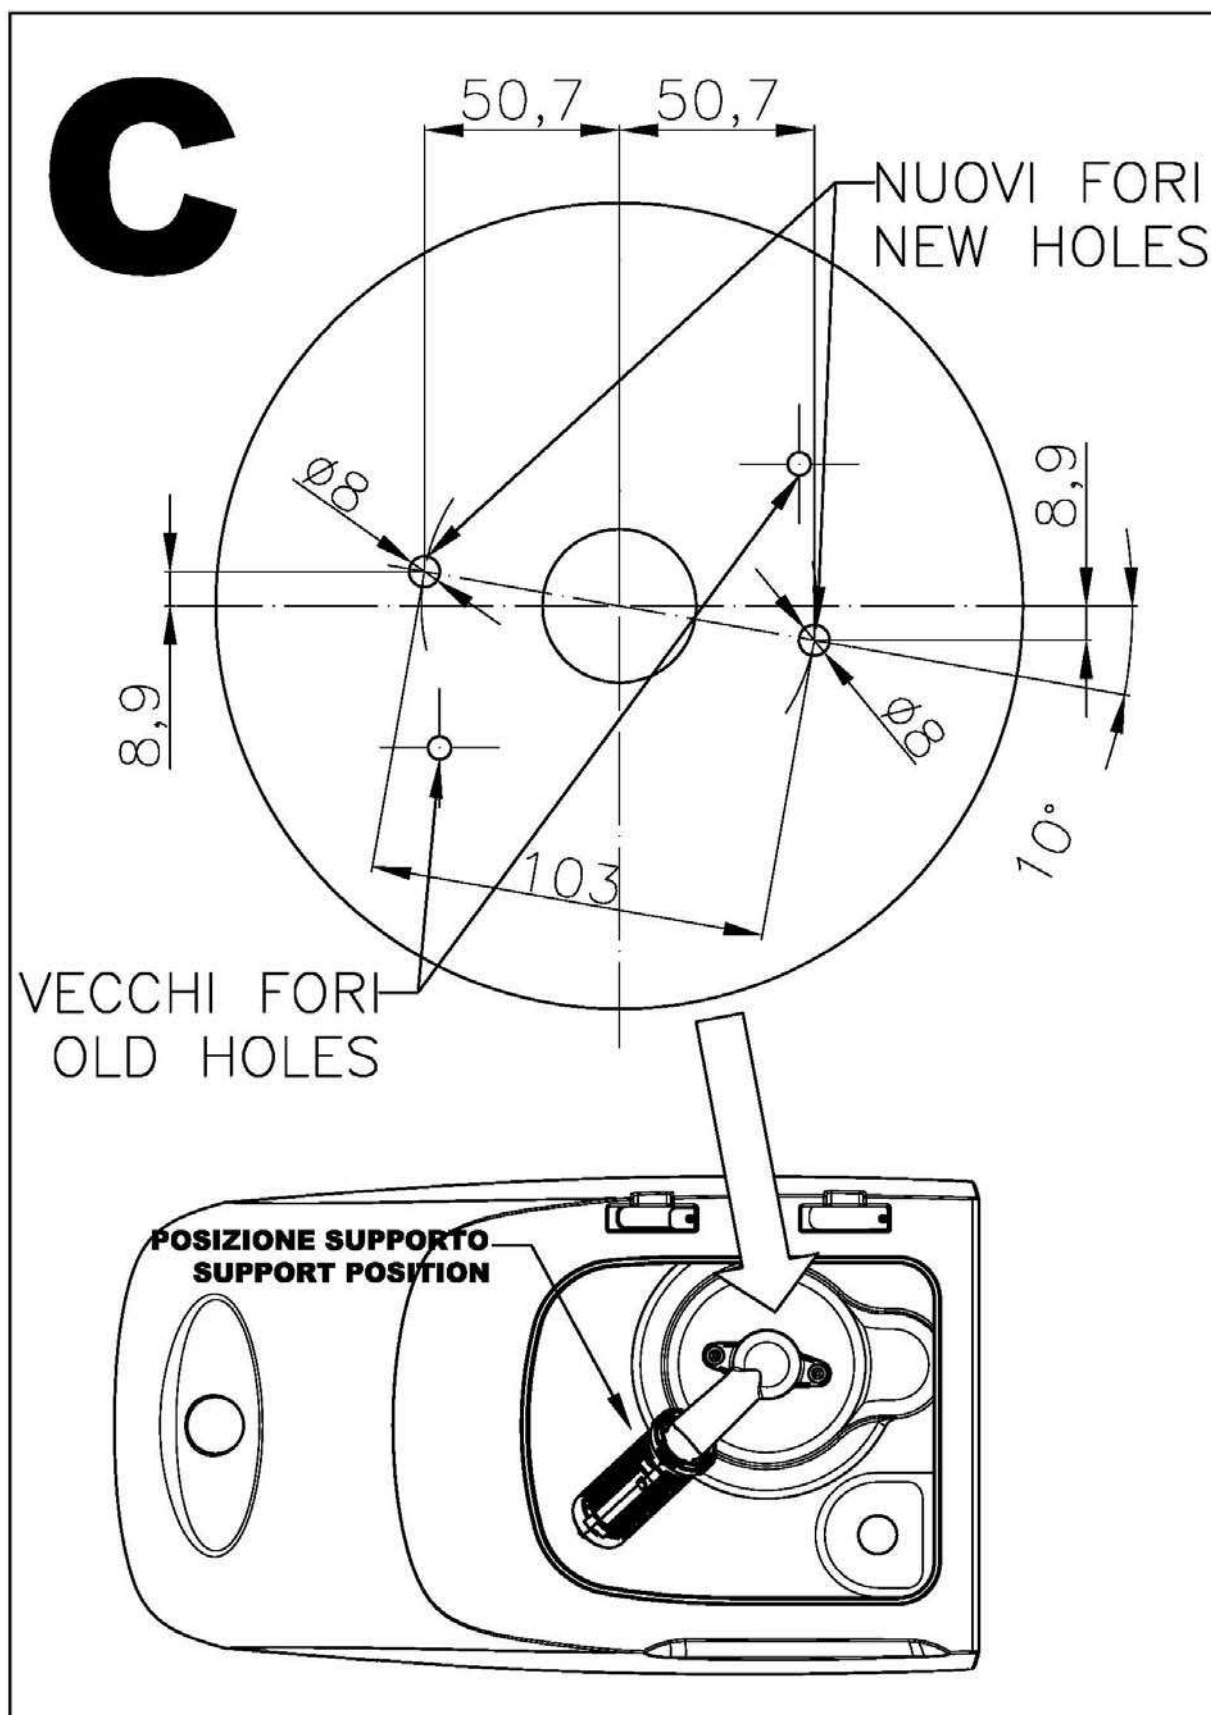

INSTALLATION INSTRUCTIONS				Description
Part No	9097731000	Date	18/03/2008	Installation Instruction for
Page	5/5	Release		KIT SUPPORTO GALLEGGIANTE
Issue by	R&D	Machine type		CAGE FLOAT HOLDER KIT
Name	Odoli	Product index		9097730000

