



Nilfisk

TECHNICAL SERVICE BULLETIN

Number: TSB-FC-2016-269 CS7000 Shaker
motor ground connection

Symptom: Inability to remove shaker frame
assembly

Date: July 10, 2016

Urgency: Low

Author: Aaron Clark

Urgency:



LOW: Rework to be done
if necessary

SYMPTOM:

Inability to remove shaker frame assembly for service

PRODUCTS:

CS7000

SYSTEM:

Hopper Filter Shaker

ISSUE:

The shaker grounding wire is hardwired to the motor limiting the ability to hang the assembly on the hopper bracket for service if the wire is too short and preventing the removal of the assembly.

CAUSE:

The shaker ground wire is missing a quick disconnect.

ECO / ODM #:

A-12178

PRODUCTION CORRECTIVE ACTIONS:

A quick disconnect has been added to the grounding wire.

Standard existing warranty on the machine applies. Allowed labor on this repair is .75hrs.

PRODUCTION SOLUTION IMPLEMENTATION DATE and / or SERIAL NUMBER:

First production machine with new Shaker ground wire connector installed as Standard equipment:

Implementation Shipping Date: 27th July, 2016

Serial Number: 1000062848

Urgency:




LOW: Rework to be done if necessary

FIELD CORRECTIVE ACTIONS: (All machines built prior to Serial Number 1000062848)

Order and install the new SHAKER PIGTAIL KIT PN 56511376.

SPARE PARTS or Kits Needed:

56511376 SHAKER PIGTAIL KIT - to allow removal of shaker assembly with a quick disconnect for the grounding wire.

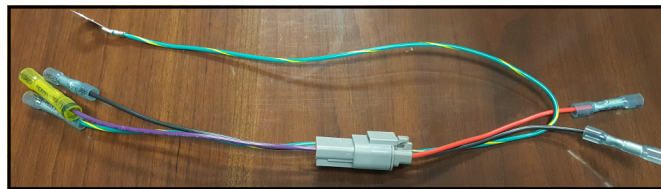

COMPONENT LOCATIONS / PICTURES:

Serial Number Tag

The Model Number and Serial Number of your machine are shown on the Nameplate. One nameplate is located on the wall of the operator's compartment just below the circuit breaker decal. The second nameplate is located on the chassis beneath the recovery tank.

