

Machines


Machine	TASKI swingo 350
Subassembly	Charger

Spare part set charger

Due to a high rate of failures of the 5A charger in the field we have prepared a spare part set for older TASKI swingo 350B. Besides the charger, it includes a rear cover panel as well as two adaptor cables and the corresponding mounting material. Also a mounting instruction is in the set.

Important is after replacing the old 5A Charger to check if the setting of the charging curve is the appropriate one. This can be done by using the DIP-switches, which are located underneath the stopple. Preset ex-factory is always the GEL-curve.

The main cord is NOT included. This has to be ordered separately. Caution: For the new charger a 3-pole main cord has to be ordered as it is a protection class 1 device.

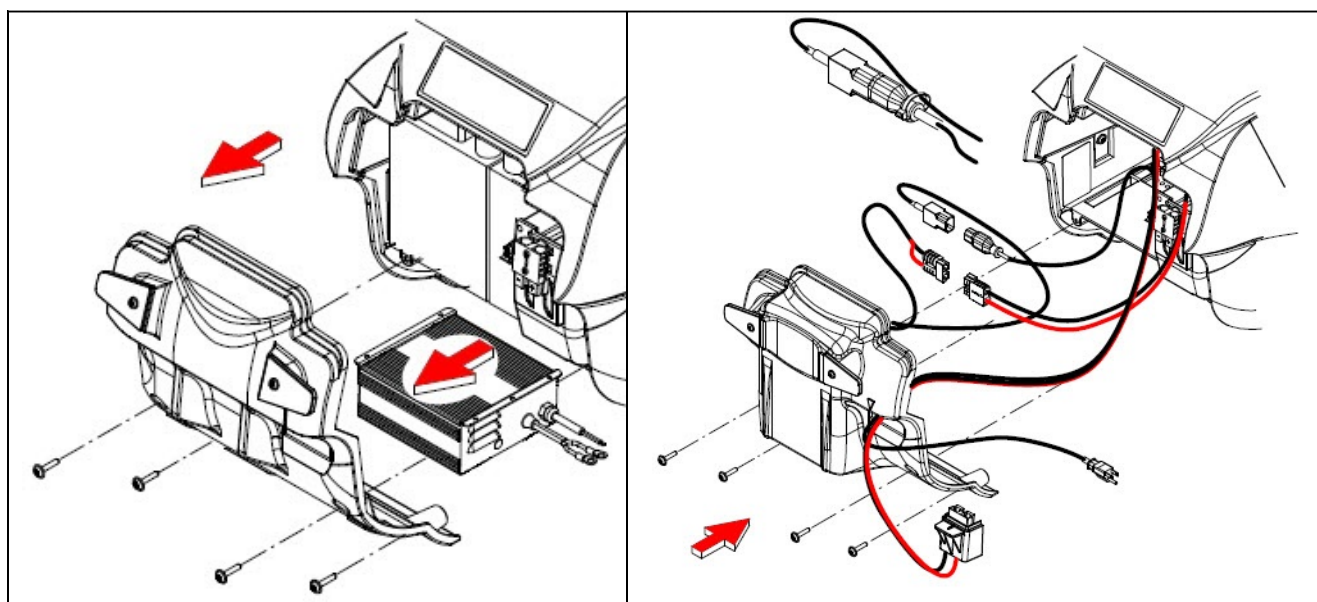

Description	Material number	Remarks
Charger set	4132834 (17422-23)	New spare part number

GTS Newsletter

2017 / 04E

Service Information

- | | |
|--|---|
| ☐ Check parts on stock | ☐ Return defective parts to Münchwilen |
| ☐ Proactive exchange recommended | ☒ NO proactive exchange recommended |
| ☒ Modification is backwards compatible | ☐ Modification is NOT backwards compatible |
| ☐ Update/modify machines in the field | ☐ Entitled to warranty |
| ☒ Dispose/recycle defective parts | ☒ Parts are available ex stock Münchwilen |
| ☐ Others | |

Production

The new charger is mounted as a standard ex-factory since the Li-Ion ready is in place.