

GTS Newsletter


2009/02E

Machines

Machine	TASKI swingo XP
Subassembly	Upper Part

New tank cover TASKI swingo XP

Due to increased feedbacks from the field that the fresh water suction hose in the area of the flex tank support (metal frame) got damaged, we have adjusted the shape of the tank cover (white marking). As a result of this modification the hose has a wider space for movements, which is preventing injuries by squeezing and rubbing on the metal frame.

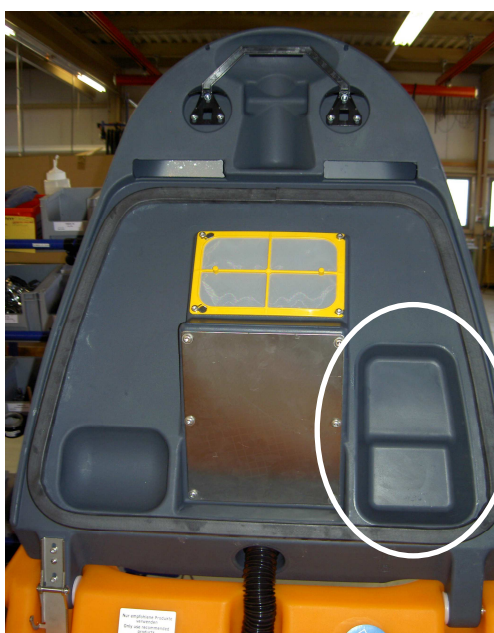

Service

The new tank cover is reverse compatible and can be ordered under the existing material number 4124371 (18600-89)

Proactively exchanged tank covers will not be reimbursed under warranty.

Production

TASKI swingo XP

as of machine number 2981