

GTS Newsletter


2008/06E

Machine

Machine	TASKI swingo XP
Subassembly	Chassis

Squeegee Lowering Mechanism

Feedbacks from the market have indicated that due to permanent moving of the bolt the squeegee lowering mechanism can extend and damage the relevant passage in the chassis. Because of this reason a set which can be fitted into the existing machines is now available.

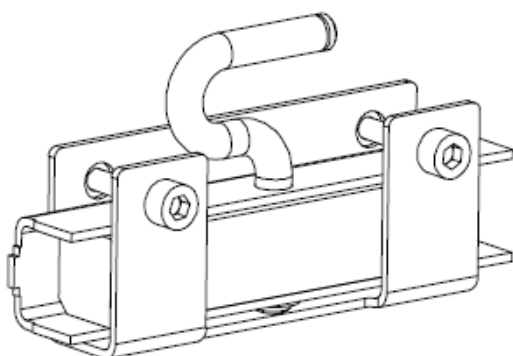

Description	Material Number	Status
Squeegee lowering mechanism modification set	4127903 (18603-32)	available
Remarks	-	-

⚠ CAUTION

The relevant strengthening of the chassis has been realised from machine no. 2410.

Service

When doing a regular service on a TASKI swingo XP we recommend a thoroughly visual examination of the chassis. If the first signs of damage are visible the modification set has to be mounted.